



Falcon

20 SERIES

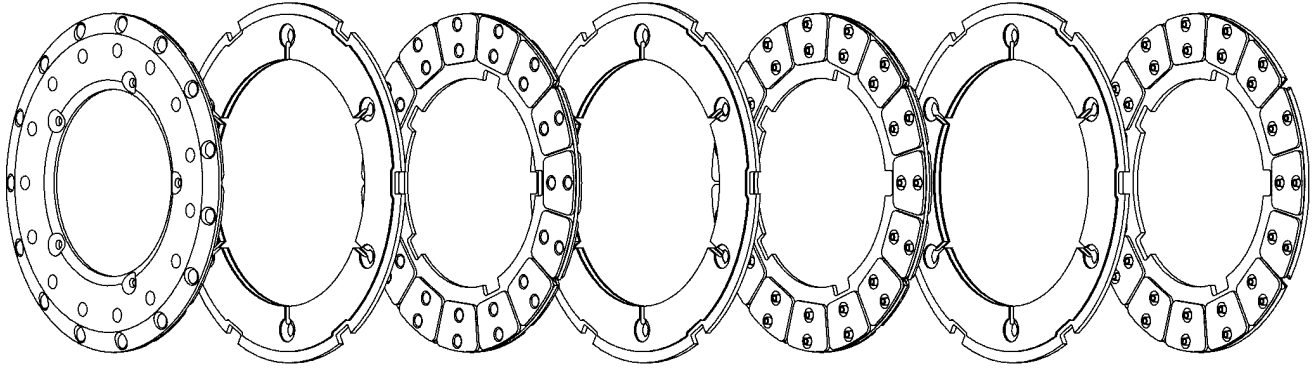

FAA-PMA APPROVED

Replacement Brake Parts

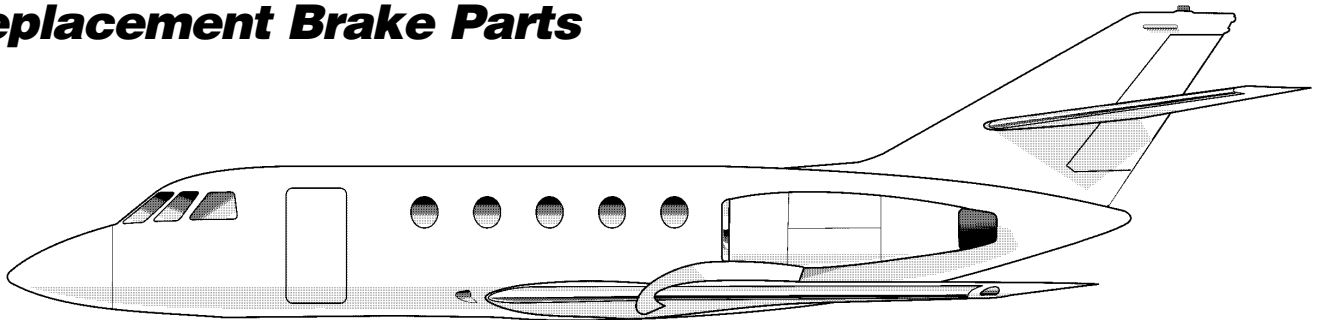

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES


440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



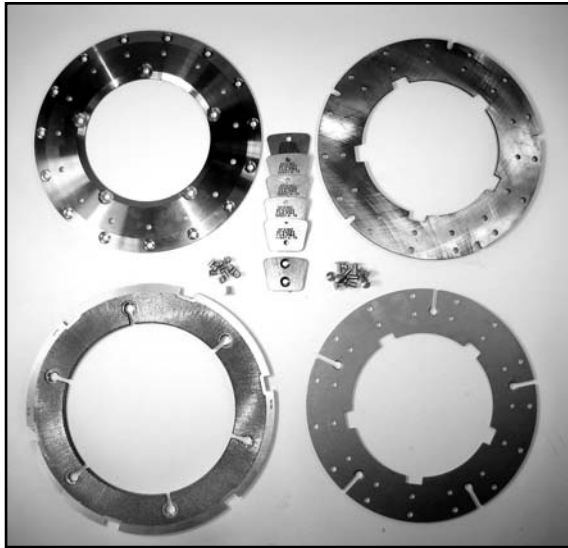

This Brake Kit fits the following:

Dassault Falcon 20 when equipped with Goodyear/ABSC brake assembly 9550504

Rapco Fleet Support, Inc. to ABSC Part Number cross-reference:

	Qty	RFS Part PN	ABSC PN	Part Description
RFS-9550504K Hot-Pac Kit Contents	3	RFS1065	9542927	Rotating Disc
	90	RFS3085	5000207	Wear Pad
	30	RFS18B8	GY18B8	Rivet (Pressure Plate)
	15	RFS18B9	GY18B9	Rivet (Back Plate)
	15	RFS18B16	GY18B16	Rivet (Back Plate)
	60	RFS18A13	GY18A13	Rivet (Stationary Plate)
	1	RFS5110	5000209	Pressure Plate Sub-assembly*
	1	RFS4125		Pressure Plate
	1	RFS5115	5000210	Back Plate Sub-assembly*
	1	RFS4130		Back Plate
	2	RFS5120	5000208	Stationary Disc Sub-assembly*
	2	RFS2045	9542648	Stationary Disc

* These parts are sold as a Sub-Assembly with the wear pads already riveted on.

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.


For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax www.rfsbrakes.com




Hawker

600 & 700

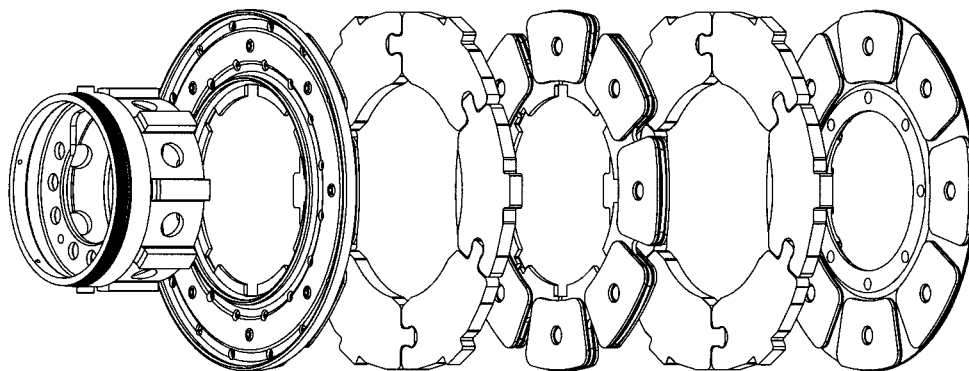

FAA-PMA APPROVED

Replacement Brake Parts

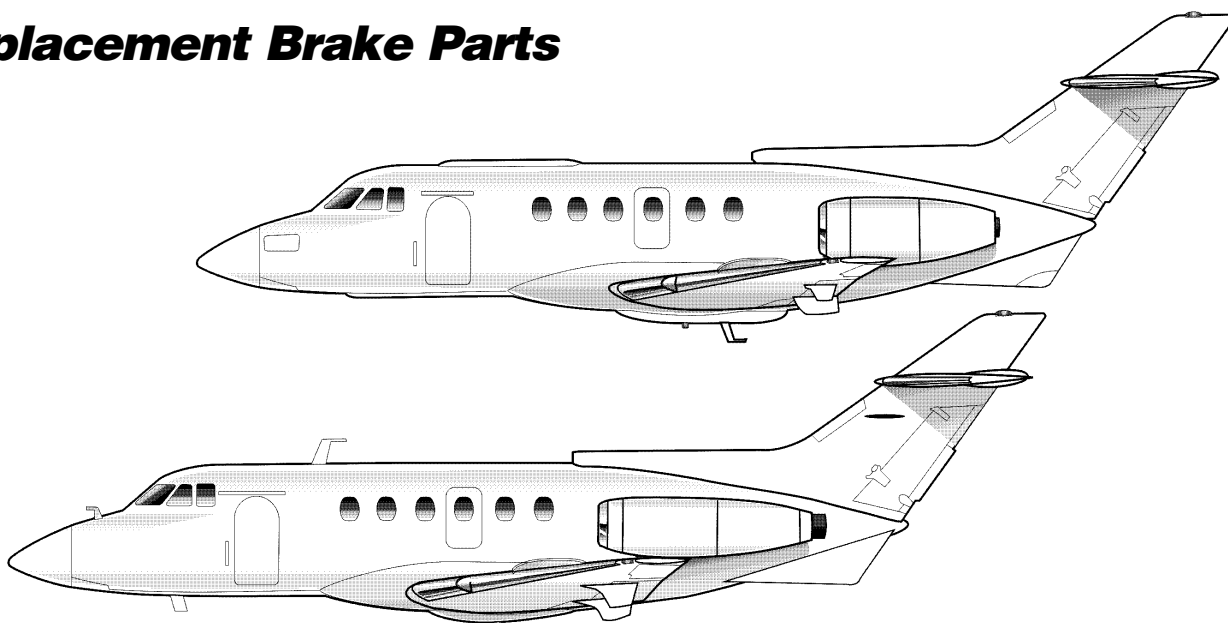

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com





This Brake Kit fits the following:

Hawker 600 & 700 When equipped with Dunlop brake assembly AH52787

Rapco Fleet Support, Inc. to Dunlop Part Number cross-reference:

	Qty	RFS Part PN	Dunlop PN	Part Description
RFS-52787K Hot-Pac Kit Contents	12	RFS1060	AHM7129	Rotating Disc Segment
	32	RFS3075	AHO83829-6	Wear Pad
	16	RFS80972-1	AHO80972-1	Rivet, Stationary & Back Plate
	8	RFS80972-3	AHO80972-3	Rivet, Pressure Plate
	16	RFS80972-4	AHO80972-4	Rivet - (used on Galex)
	1	RFS2040	AHM7151	Stationary Disc
	1	RFS4115	AHM8974	Pressure Plate
	1	RFS4116	AHM7152	Pressure Plate (optional)
	1	RFS4120	AHM7127	Back Plate
	1	RFS5095*	AHO85004	Stationary Disc Sub-assembly
	1	RFS5091*	AHO85005/AHO90631	Pressure Plate Sub-assembly
	1	RFS5100*	AHO85003	Back Plate Sub-assembly
	16	RFS6210	AHO83326-7	Bushing, Pressure & Back
	8	RFS6215	AHO83327-4	Bushing, Stationary
	8	RFS6220	AHO82396	Rivet Spacer

* These parts are sold as a Sub-Assembly with the wear pads already riveted on. These parts are NOT sold as part of RFS-52787K Hot Pac kit.

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call


(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com




Hawker

800 & 800XP

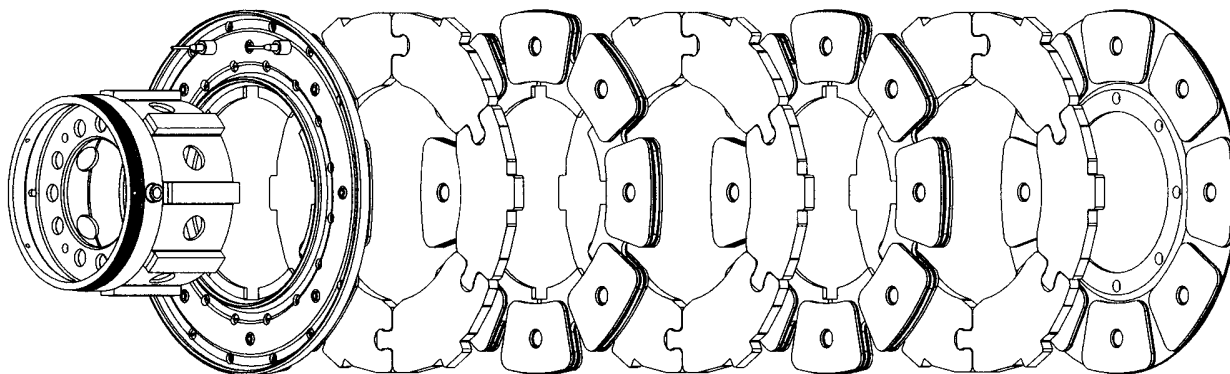

FAA-PMA APPROVED

Replacement Brake Parts

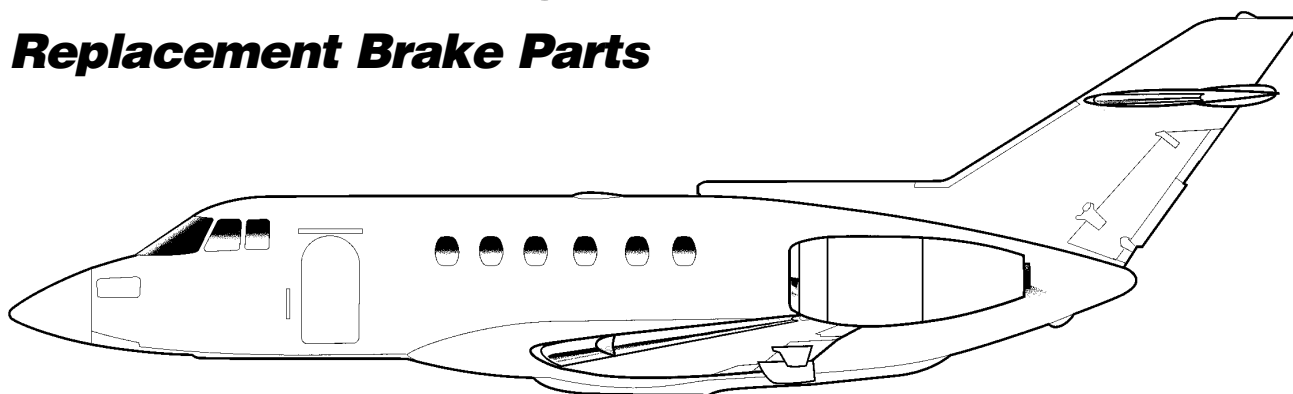

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES


440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



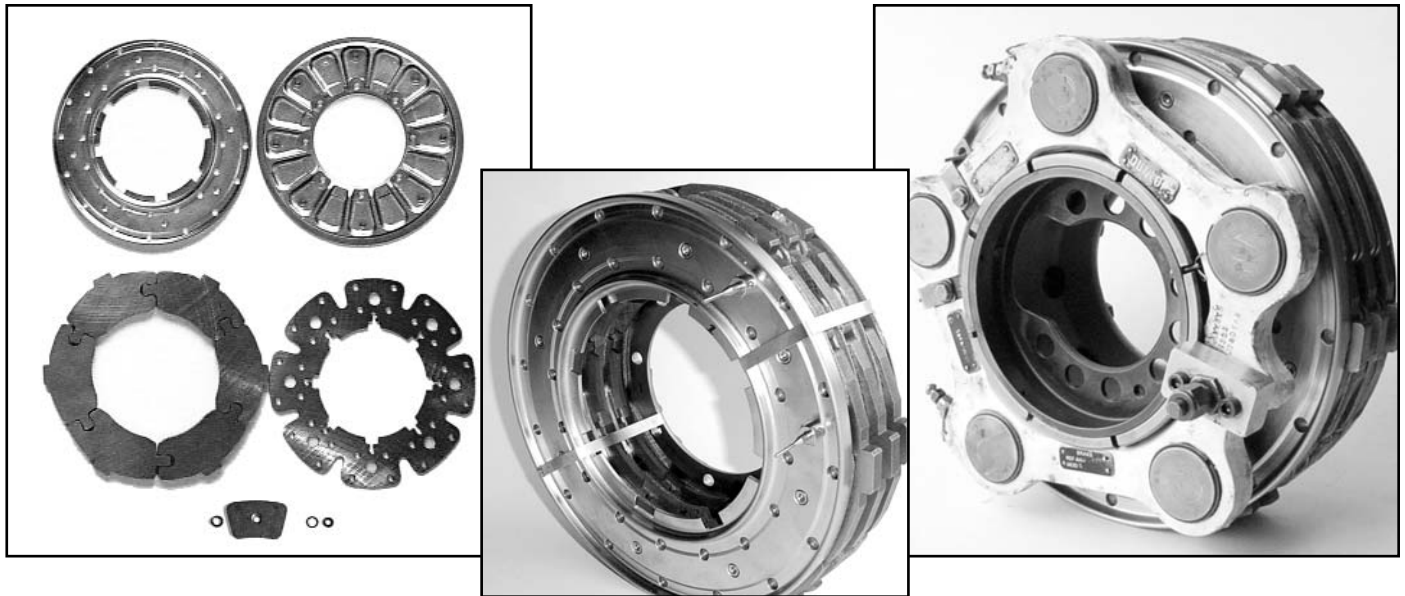

This Brake Kit fits the following:

Hawker 800, 800XP When equipped with Dunlop brake assembly AHA1897

Rapco Fleet Support, Inc. to Dunlop Part Number cross-reference:

RFS1897K Hot-Pac Kit Contents	QTY	RFS Part No.	Dunlop P.N.	Part Description
	18	RFS1050	AHM9053	Rotating Disc Segment
	48	RFS3075	AHO83829-6	Wear Pad
	24	RFS80972-1	AHO80972-1	Rivet, Stationary & Back Plate
	8	RFS80972-3	AHO80972-3	Rivet, Pressure Plate
	2	RFS2040 ^	AHM7151	Stationary Disc
	1	RFS4115 ^	AHM8974	Pressure Plate
	1	RFS4120 ^	AHM7127	Back Plate
	1	RFS5090 *	AHO89880	Pressure Plate Sub-assembly
	2	RFS5095 *	AHO85004	Stationary Disc Sub-assembly
	1	RFS5100 *	AHO85003	Back Plate Sub-assembly
	16	RFS6210 ^	AHO83326-7	Bushing, Pressure & Back
	16	RFS6215 ^	AHO83327-4	Bushing, Stationary
	8	RFS6220 ^	AHO82396	Rivet Spacer
	2	RFS6305 ^	AHO89645	Wear Indicator Pin
	2	RFS6310 ^	AHO89040	Pin Retainer

^ Not part of kit.

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call


(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com




Cessna Citation

500 & 550

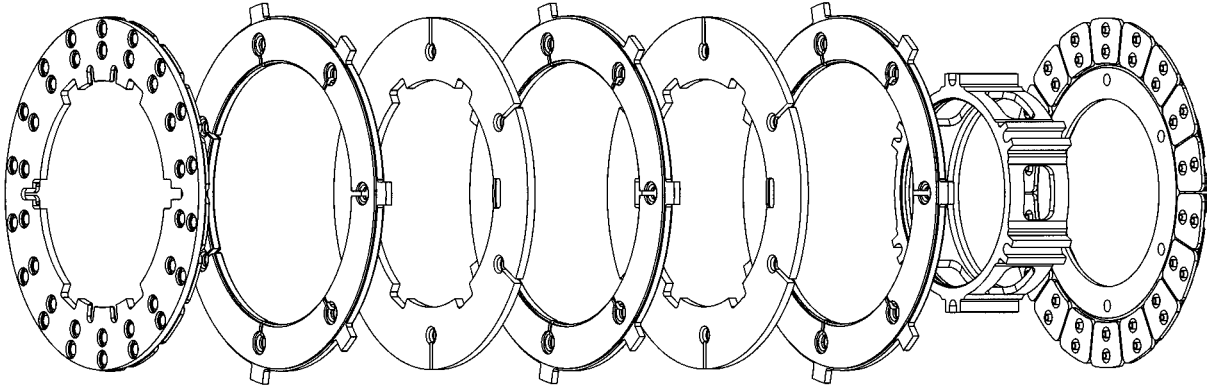

FAA-PMA APPROVED

Replacement Brake Parts

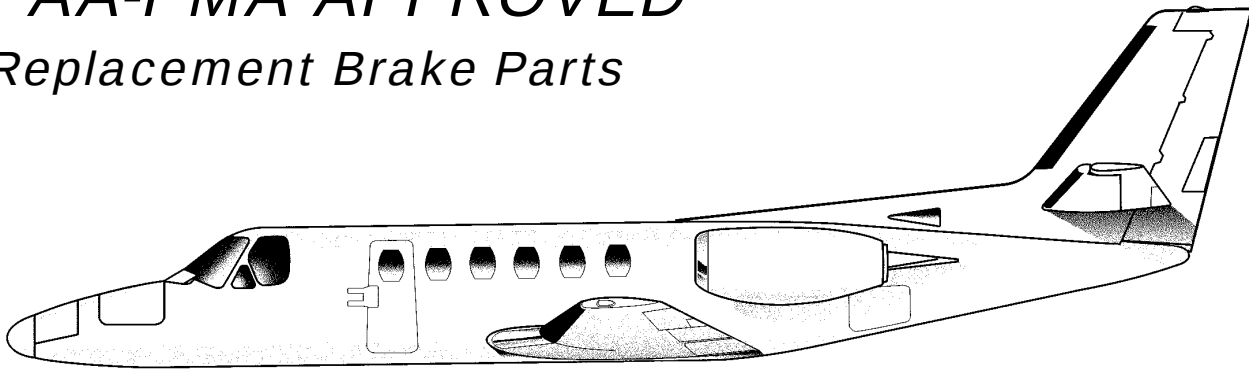

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.


For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



Distributed By:

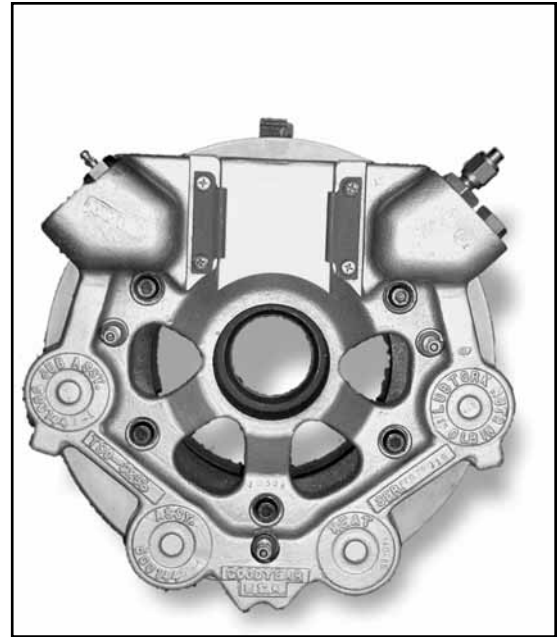

This Brake Kit fits the following:

Cessna Citation models 500 & 550 when equipped with ABS brake assemblies 5001445 series or 5001446 series.

Rapco Fleet Support, Inc. to Goodyear / ABS Part Number cross-reference:

	QTY	RFS Part No.	Goodyear/ ABS P.N.	Part Description
RFS-1446K Hot-Pac Kit Contents	36	RFS3070	5003537	Wear Pad
	18	RFS16B7	GY16B7	Rivet
	18	RFS16B16	GY16B16	Rivet
	3	RFS1045	5003540	Rotating Disc
	2	RFS2035	5003541	Stationary Disc
	36	RFS16B9	GY16B9	Rivet
	6	RFS6125 ^	5003542-1	Piston Insulator
	6	RFS6115 ^	5001540	Piston
	1	RFS5060 *	5003538	Back Plate Sub-Assembly
	1	RFS4110 ^	5003539	Back Plate
	1	RFS5065 *	5003536	Pressure Plate Sub-Assembly
	1	RFS4105 ^	5002546	Pressure Plate
	1	RFS6105 ^	5001452	Torque Tube
	7	RFS6110 ^	5001481	Keyway Liner

* These parts are sold as a Sub-Assembly with the wear pads already riveted on. These parts are NOT sold as part of RFS1446K Hot Pac kit. ^ Not part of kit.

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call


(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com




Gates Learjet

25, 31, 35, 35A, 36 36A & 55

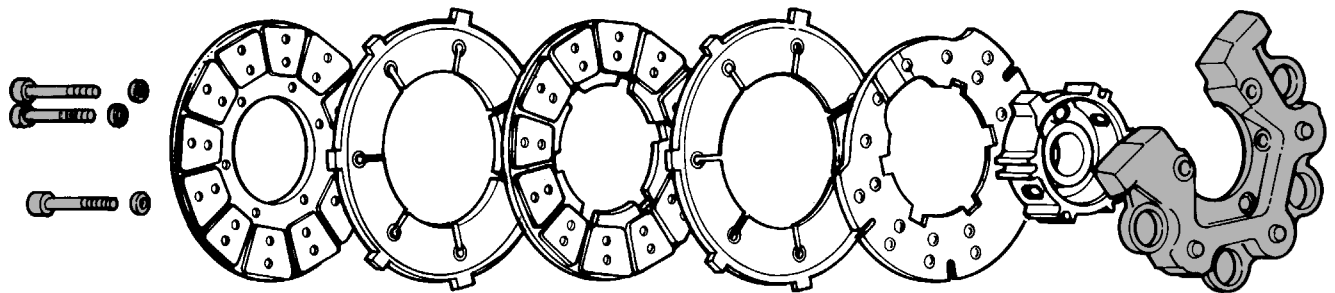

FAA-PMA APPROVED

Replacement Brake Parts

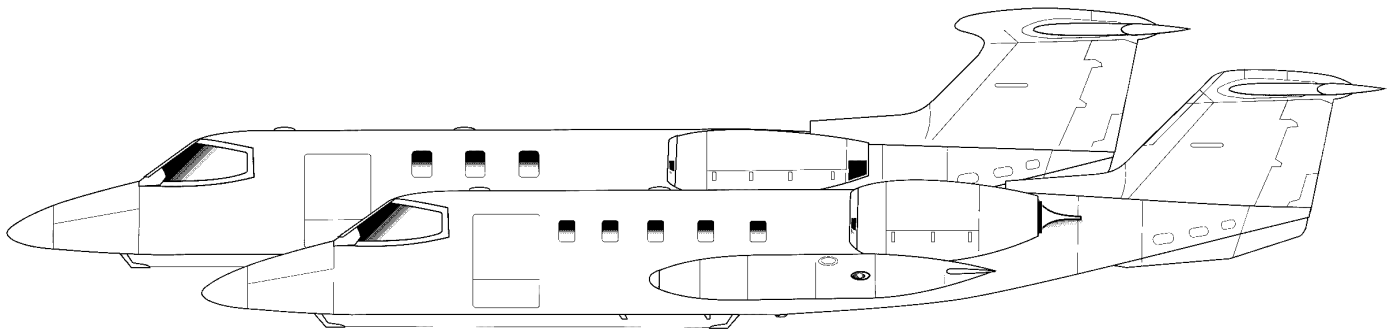

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com





This Brake Kit fits the following:

Gates Learjet: 25, 31, 35, 35A, 36, 36A and 55 when equipped with Goodyear / ABS 5003096, 5003096-1, 5003096-3, 5003096-4, or 5003096-6 brake assemblies. Specific application eligibility below.

Rapco Fleet Support, Inc. to Goodyear / ABS Part Number cross reference:

QTY	RFS Part No.	Goodyear/ ABS P.N.	Part Description	Application Eligibility
2	RFS6425	5006425	Rotating Disc	25,31,35,35A & 36A
44	RFS6029	5006029	Wear Pad	25,31,35,35A & 36A
1	RFS5119	5005119	Wear Pad	25,31,35,35A & 36A
24	RFS18A15	GY 18A-15	Rivet	25,31,35,35A & 36A
12	RFS18B7	GY 18B-7	Rivet	25,31,35,35A & 36A
20	RFS18B9	GY 18B-9	Rivet	25,31,35,35A & 36A
12	RFS18B15	GY 18B-15	Rivet	25,31,35,35A & 36A
1	RFS4090 ^	5005118	Pressure Plate	25,31,35,35A,36,36A & 55
1	RFS4095 ^	9536254	Stationary Disk	25,31,35,35A,36,36A & 55
1	RFS4100 ^	9536256	Back Plate	25,31,35,35A,36,36A & 55
1	RFS5070 *	9544027	Back Plate Sub Assy	25,31,35,35A,36,36A & 55
1	RFS5075 *	9544028	Stationary Disc Sub Assy	25,31,35,35A,36,36A & 55
1	RFS5080 *	5005117-1	Pressure Plate Sub Assy	25,31,35,35A,36,36A & 55
1	RFS5006905 ^	5006905	Torque Tube	25,35,35A,36,36A & 55

* These parts are sold as a Sub-Assembly with the wear pads already riveted on. * ^ These parts are NOT sold as part of RFS-3096K Hot Pac kit.

FAA-PMA APPROVED
Replacement Brake Parts
RAPCO FLEET SUPPORT, inc.



AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.


For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com


High Float Beech Super King Air

200 SERIES

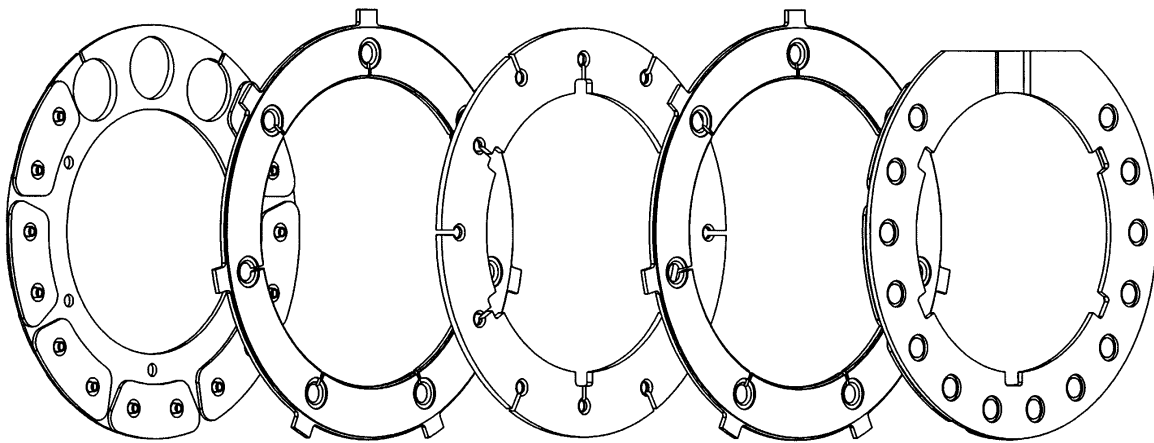

FAA-PMA APPROVED

Replacement Brake Parts

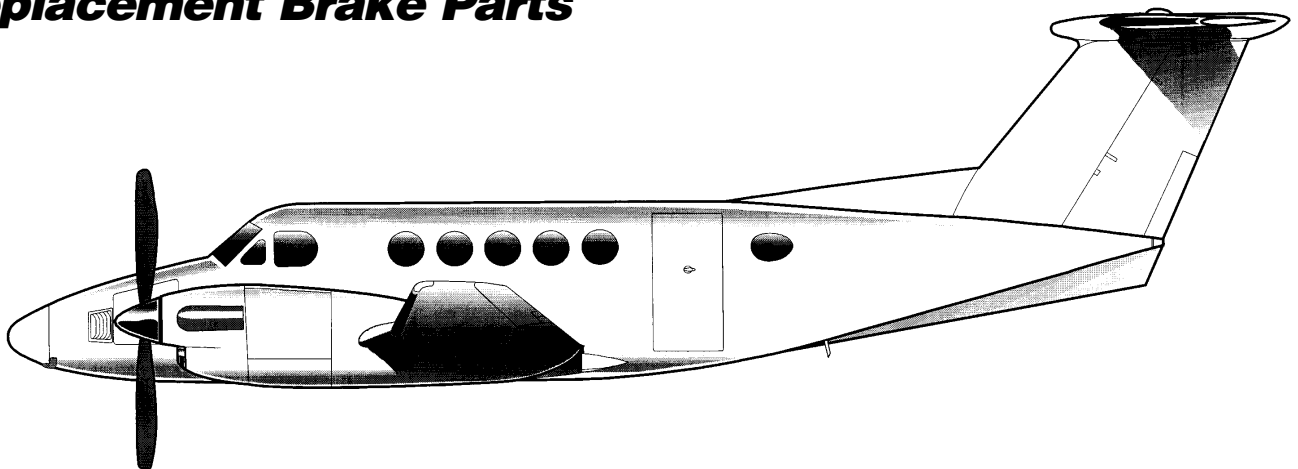

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES



440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



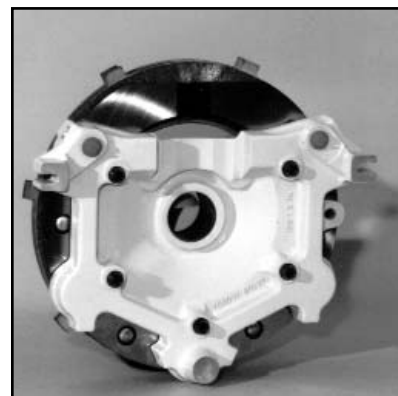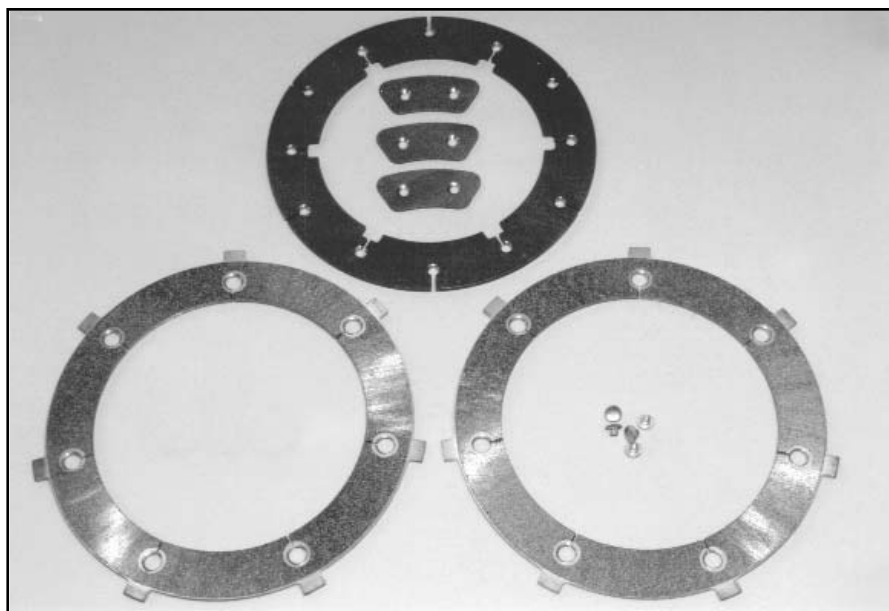

This Brake Kit fits the following:

Beech: 200 series aircraft equipped with ABS brake assembly 5002256 or Beech part number 101-8002-3.

Rapco Fleet Support, Inc. to ABS and Beech Part Number cross reference:

	QTY	R.F.S. Part No.	ABS Part No.	Beech Part No.	Part Description
RFS-2256K Hot-Pac Kit Contents	2	RFS1030	5002260	101-8002-13	Rotating Disc
	1	RFS2015	5002259	101-8002-15	Stationary Disc
	14	RFS3030	5002105	101-8002-33	Wear Pad
	28	RFS18B7	GY18B7		Rivet
	1	RFS5050*	5002265	101-8002-11	Back Plate Sub Assembly
	1	RFS5055*	5002258	101-8002-17	Pressure Plate Sub Assy

* These parts are sold as a sub assembly with the RFS3030 already riveted on.

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.


AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.
For a list of distributors, Please call
(262) 367-6210 Phone, (262) 367-6219 Fax
www.rfsbrakes.com




Beech Super King Air

200, 200C

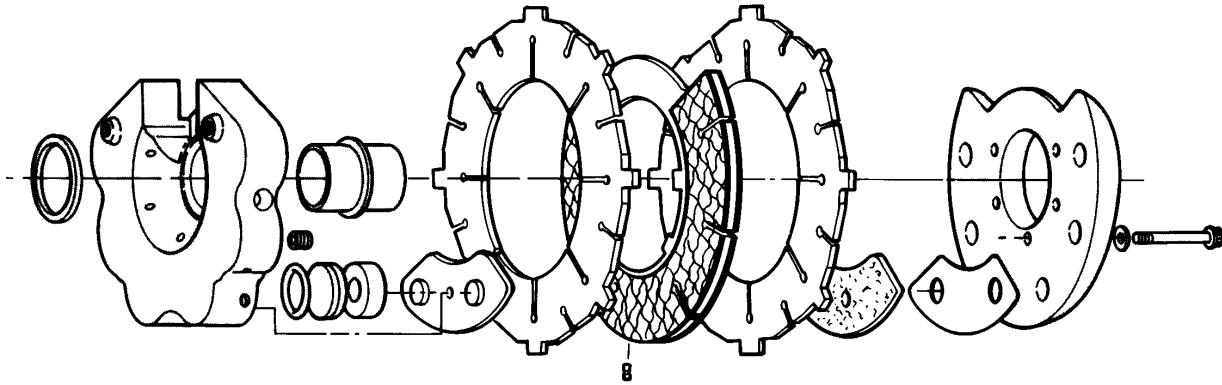

FAA-PMA APPROVED

Replacement Brake Parts

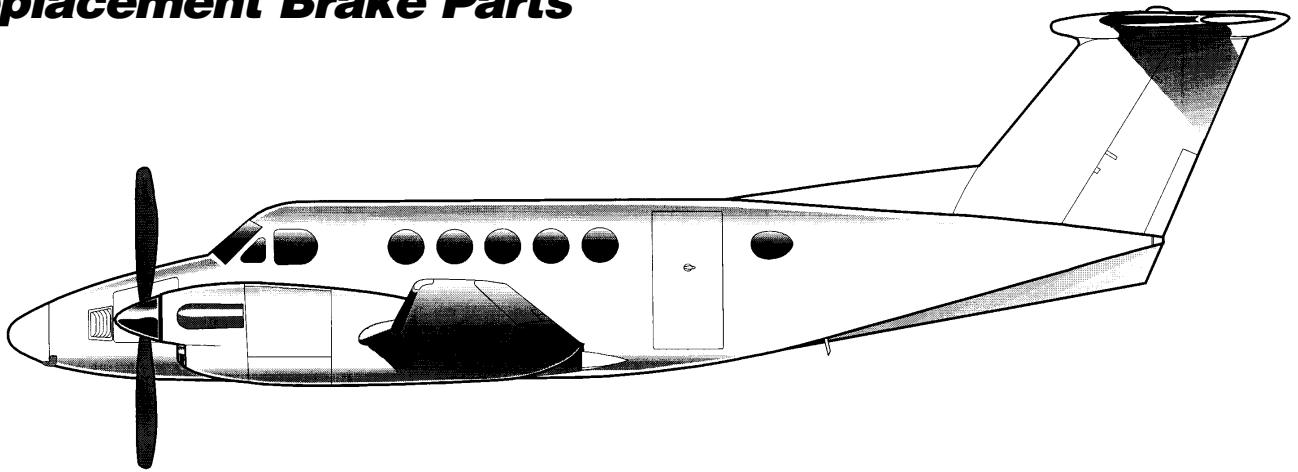

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES


440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



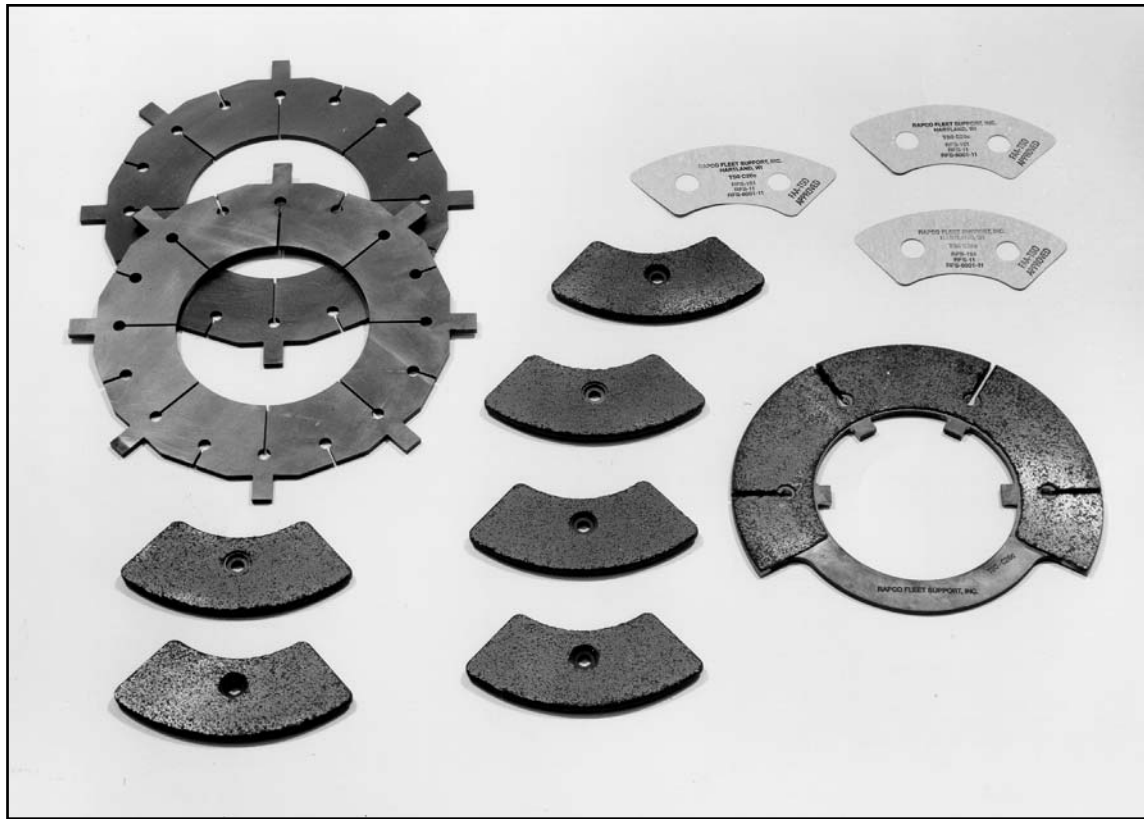

This Brake Kit fits the following:

Beech: King Air 200 and King Air 200C when equipped with B.F.G. P.N. 2-1576 or Beech P.N.'s 101-8001-9, 101-380096-1 or 101-8001-91 brake assemblies.

Rapco Fleet Support, Inc. to B.F. Goodrich and Beech Part Number cross reference:

RFS-15K Hot-Pac Kit Contents	QTY	R.F.S. Part No.	B.F.G. Part No. 101 Series	B.F.G. Part No. 2-1576	Beech Part No.	Part Description
	6	RFS207-111	342-93	342-144	101-8001-111	Wear Pad
	1	RFS-27	244-416	244-669	101-8001-27	Stationary Disc
	2	RFS-15	133-420	133-1097	101-8001-15	Rotating Disc
	3	RFS-151	115-151	115-151-2	115-8001-11	Insulator (Lining)

FAA-PMA APPROVED

Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.


For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax


www.rfsbrakes.com



Beech 99 Airliners, King Airs and Fairchild Metros

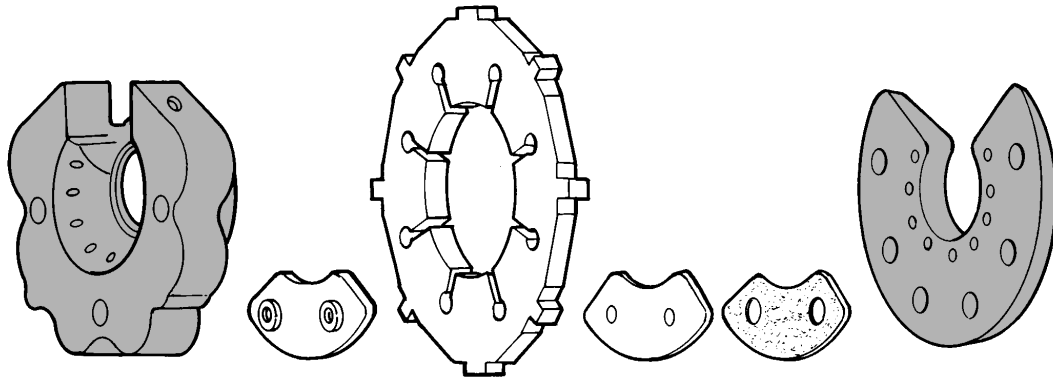

FAA-PMA APPROVED
Replacement Brake Parts

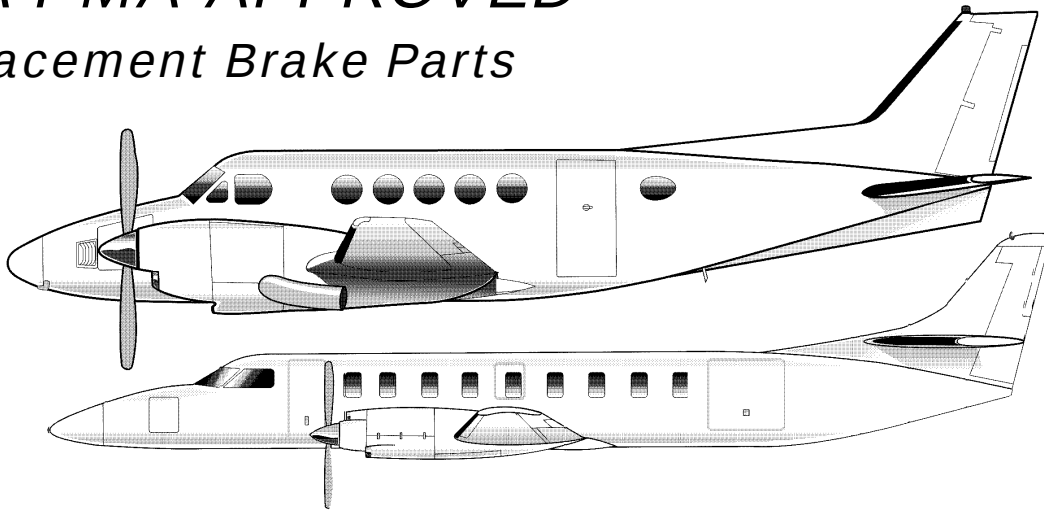

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES



440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



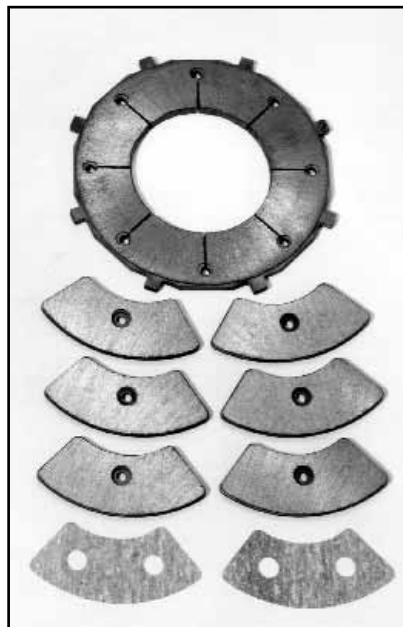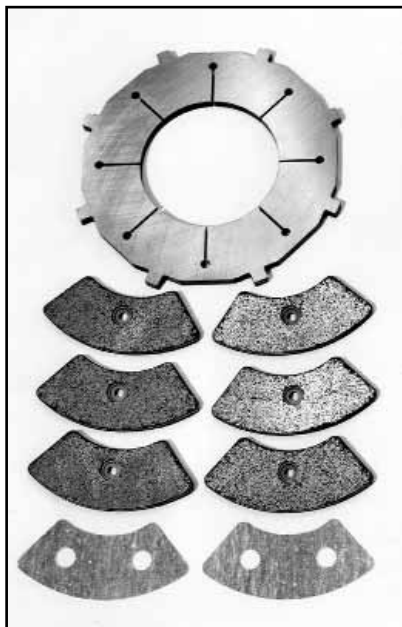

This Brake Kit fits the following:

Beech: B99, 99A, A99, A99A and C99 Airliner; King Air F90, 100, A100, and B100 when equipped with Beech 115-8001-3 brake assemblies.

Fairchild: Metro II, Metro III when equipped with B.F. Goodrich 2-1203 series brakes.

Rapco Fleet Support, Inc. to B.F. Goodrich and Beech Part Number cross reference:

QTY	R.F.S. Part No.	B.F.G. Part No.	Beech Part No.	Part Description
6	RFS207-4	342-24	115-8001-7	Wear Pad
6	RFS207-9	342-89		Wear Pad
1	RFS1587	244-528		Rotating Disc
1	RFS2587	133-268	115-8001-15	Rotating Disc
3	RFS-151	115-151	115-8001-11	Insulator (Lining)

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT_{,inc.}

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call


(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com




Beechcraft 1900

BE1900C, BE1900D AIRLINERS

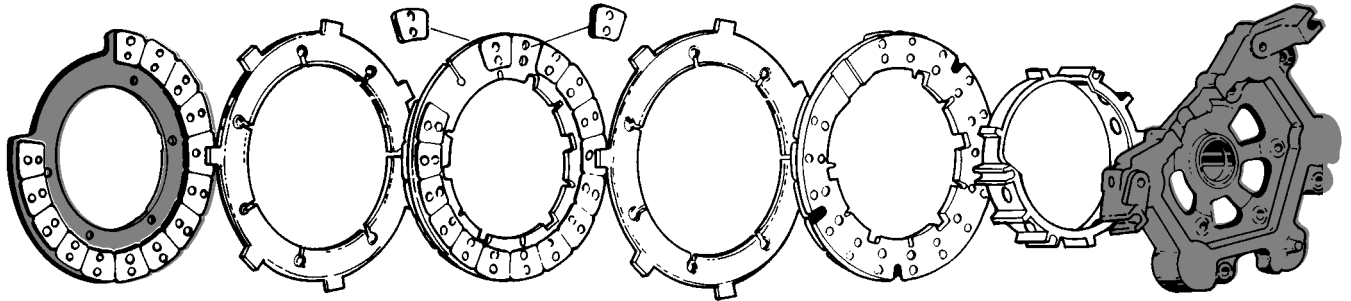

FAA-PMA APPROVED

Replacement Brake Parts

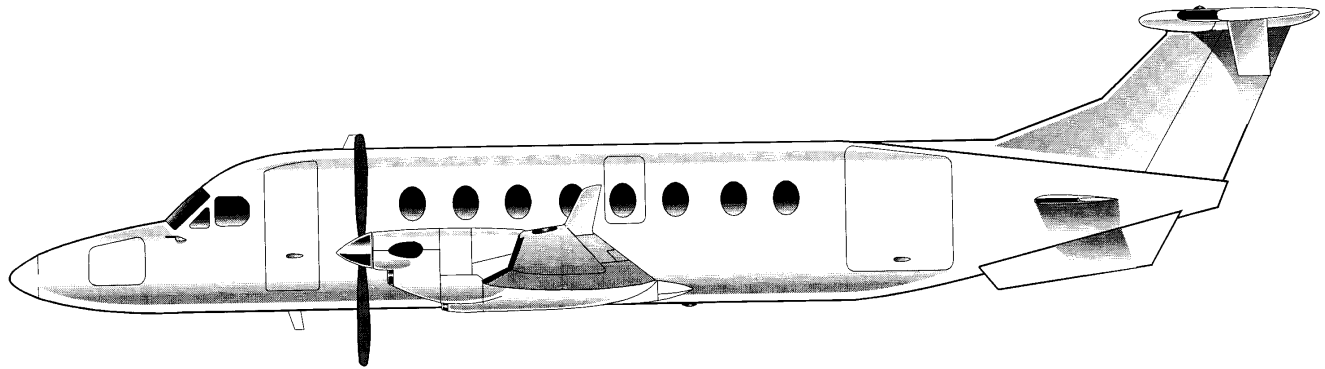

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES



440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



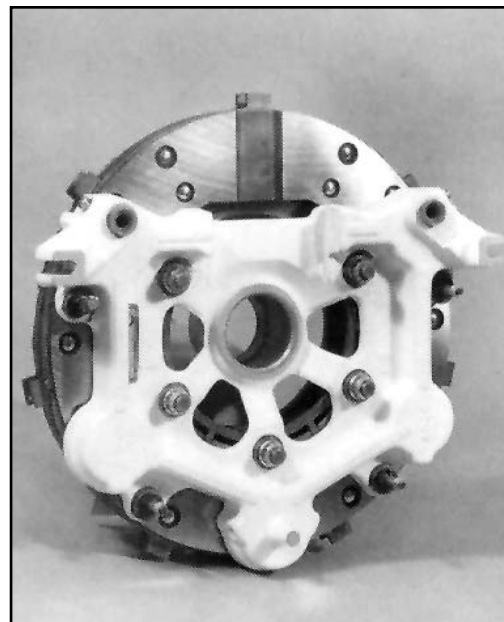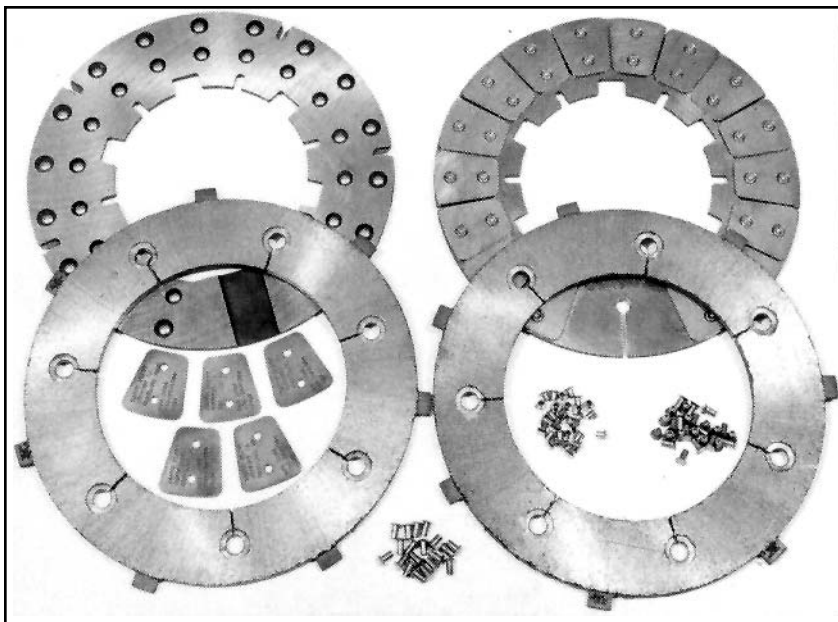

This Brake Kit fits the following:

Beech: B-1900 Airliner, models BE1900C and BE1900D with ABS P.N. 5006749-4, 5006749-5 brake assemblies, or Beech P.N. 114-8008-3, 114-388024-1 brake assemblies.

Rapco Fleet Support, Inc. to Beech / ABS Part Number cross reference:

QTY	Rapco Fleet Support P.N.	Beech/ABS P.N.	Part Description
1	RFS5010 *	114-8008-15	Pressure Plate Sub-Assembly
1	RFS5005 *	114-8008-17	Stationary Disc Sub-Assembly
1	RFS5015 *	114-8008-21	Back Plate - Exchange Only
62	RFS3005	114-8008-53	Wear Pad
2	RFS1005	114-8008-57	Rotating Disc
2	RFS1005A	5012405	Rotating Disc - Heavy Duty
32	RFS6A14	GYR 6A-14	Rivet
32**	RFS6B5	GYR 6B-5	Rivet
28**	RFS6B11	GYR 6B-11	Rivet
1	RFS5008895-1	5008895-1	Torque Tube

* These parts are sold as a Sub-Assembly with the RFS3005 Wear Pads already riveted on. Not sold or packaged as part of RFS6749K or RFS-6749K-1. ** There are (46) - RFS6B5 & (14) - RFS6B11 in the RFS-6749K-1 kit.

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.


For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax


www.rfsbrakes.com



High Gross Fairchild Metros

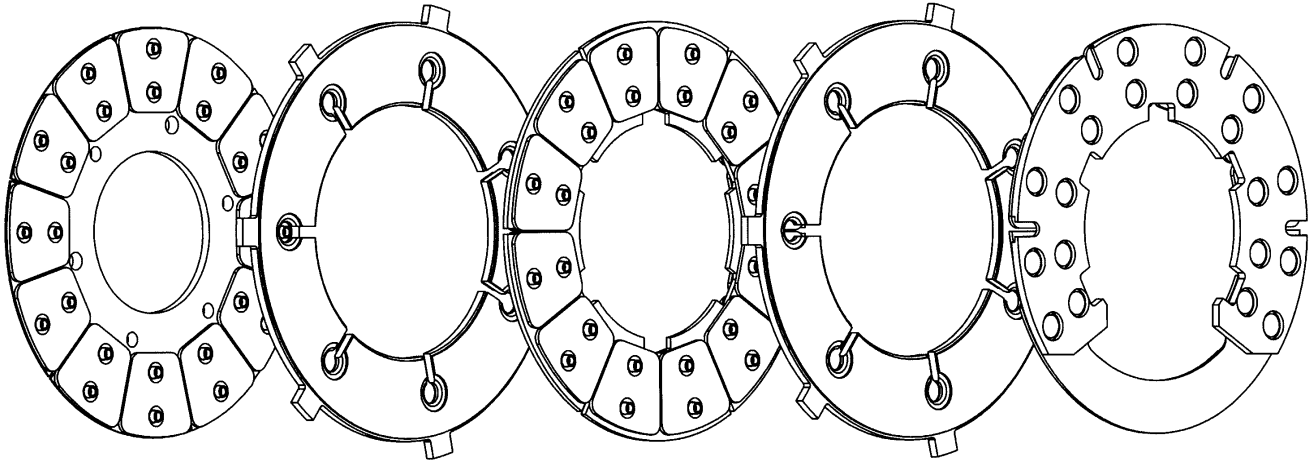

FAA-PMA APPROVED
Replacement Brake Parts

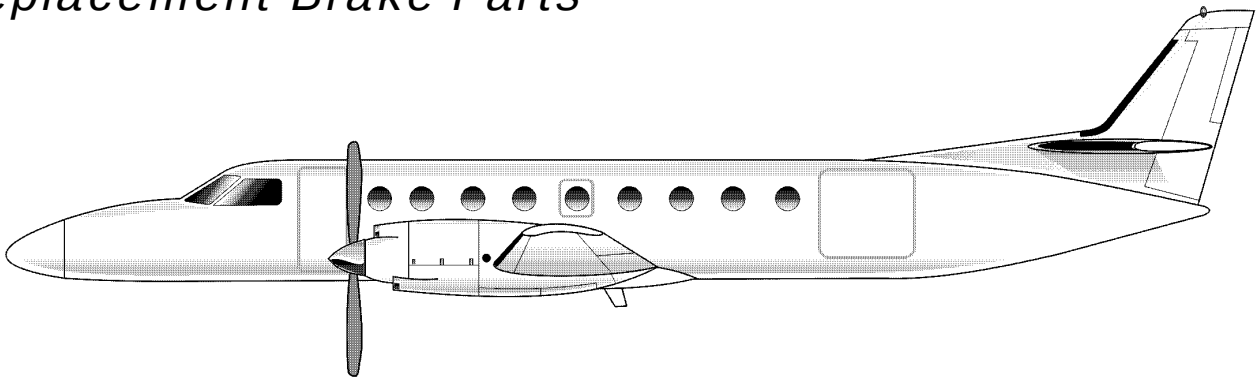

RFS

RAPCO FLEET SUPPORT, inc.

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com





This Brake Kit fits the following:

Fairchild SA227 series equipped with ABS brake assembly series 5007396 & 5011640.

Rapco Fleet Support, Inc. to ABS Part Number cross reference:

RFS-1640K Hot-Pac Kit Contents	QTY	R.F.S. Part No.	ABS Part No.	Part Description
	2	RFS1025	5011639 or 5007424	Rotating Disc
	2	RFS3020	5007440	Wear pad
	1	RFS3015	5007441	Wear pad
	42	RFS3025	5007439	Wear pad
	20	RFS8B7	GYR8B-7	Rivet
	24	RFS8A15	GYR8A-15	Rivet
	12	RFS18B14	GYR18B-14	Rivet
	12	RFS8B3	GYR8B-3	Rivet
	1	RFS5025*	5007442	Pressure Plate Sub Assembly
	1	RFS5030*	5007450	Stationary Disc Sub Assembly
	1	RFS5035*	5007444	Back Plate Sub Assembly

* These parts are sold as a sub assembly with the wear pads already riveted on.

FAA-PMA APPROVED

Replacement Brake Parts

RFS

RAPCO FLEET SUPPORT, inc.

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.


For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax


www.rfsbrakes.com



Embraer EMB-120 Airliner

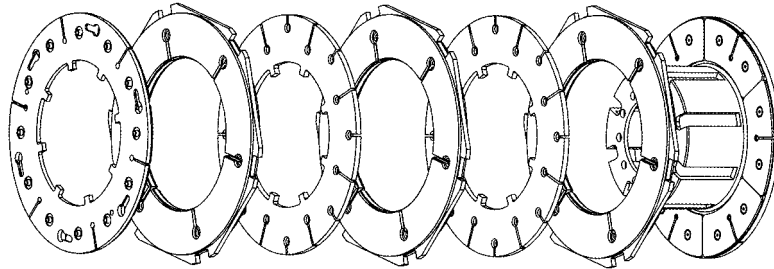


2-1479 Brake
2-1585 Brake

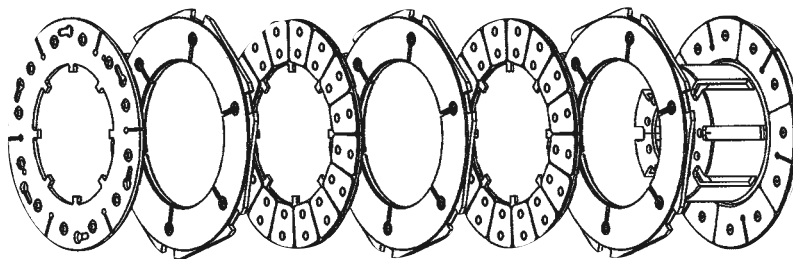

2-1661 Brake

FAA-PMA APPROVED
Replacement Brake Parts

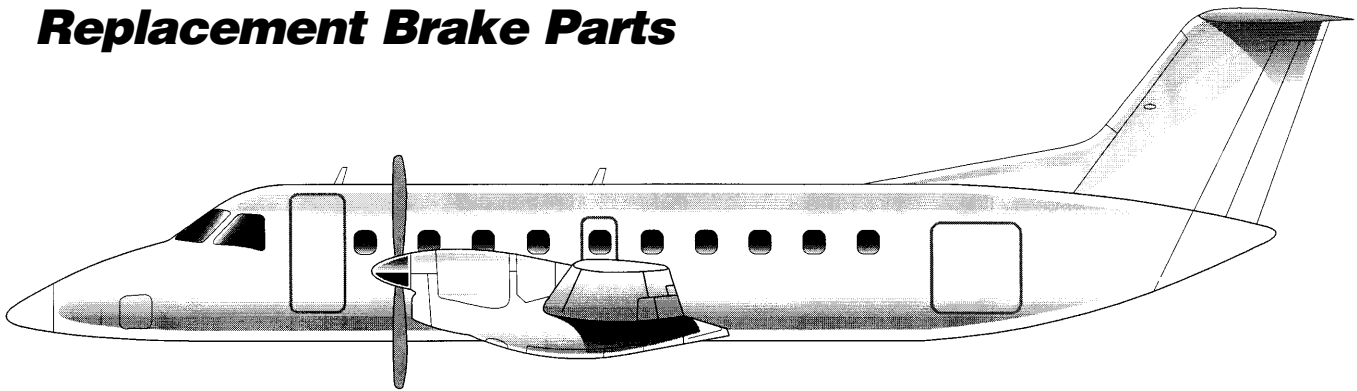

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES



440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



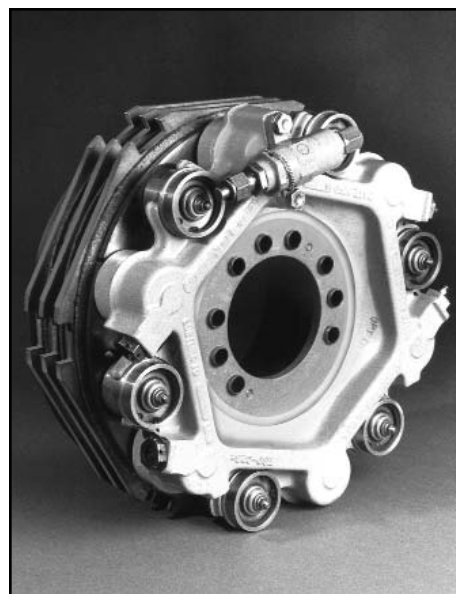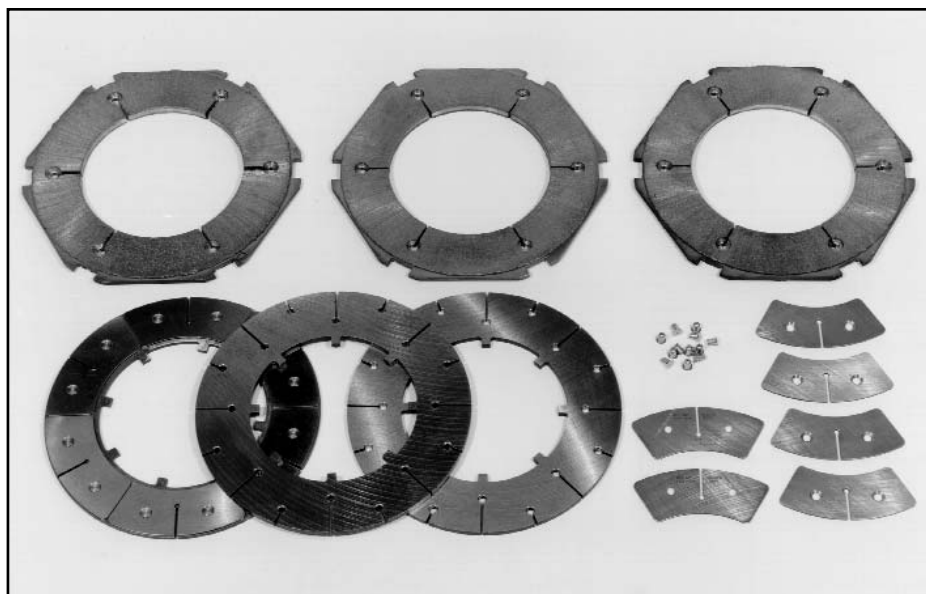

The Brake Kit fits the following:

- RFS-1479K Embraer:** EMB-120 & EMB-120RT Aircraft equipped with B.F. Goodrich P.N. **2-1479** series brakes.
- RFS-1585K Embraer:** EMB-120ER & EMB-120RT Aircraft equipped with B.F. Goodrich P.N. **2-1585** series brakes.
- RFS-1661K Embraer:** EMB-120ER & EMB-120RT Aircraft equipped with B.F. Goodrich P.N. **2-1661, 2-1585 & 2-1479** series brakes.

Rapco Fleet Support, Inc. to B.F. Goodrich Part Number cross reference:

QTY	RFS, Inc. Part No. ¹	B.F. Goodrich Part No.			Part Description
		2-1479	2-1585	2-1661	
3	RFS1015	244-608	244-667	<i>Replaced by 244-742</i>	Rotating Disc
3	RFS1015-1	-	-	244-742	Rotating Disc
2	RFS2010	133-717	133-1096	<i>Replaced by 133-1317</i>	Stationary Disc
2	RFS5155	-	-	133-1317	Stationary Disc Assembly
12	RFS3010	93-438	93-956	93-956	Wear Pad
24	RFS78-135	78-135	<i>Replaced by 78-364</i>	<i>Replaced by 78-364</i>	Rivet
24	RFS78-364	-	78-364	78-364	Rivet
1	RFS5020 *	309-21-3	309-44-3	309-44-3	Pressure Plate Assembly

¹ The part numbers of individual components are identical for both the RFS-1479K, RFS-1585K.

* These parts are sold as a Sub-Assembly with the RFS3010 Wear Pads already riveted on and is not included in the "Hot Pac" Kit.

FAA-PMA APPROVED

Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.


For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com




BAe Jetstream J31 Airliner

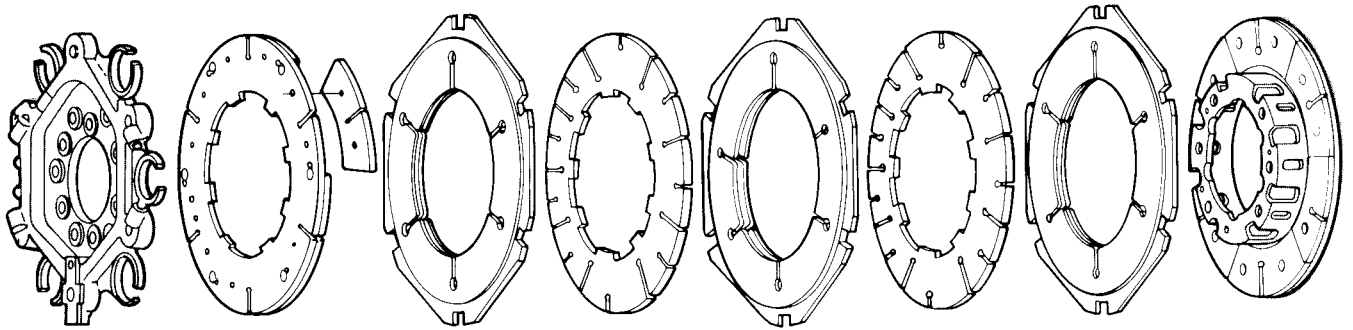

FAA-PMA APPROVED

Replacement Brake Parts

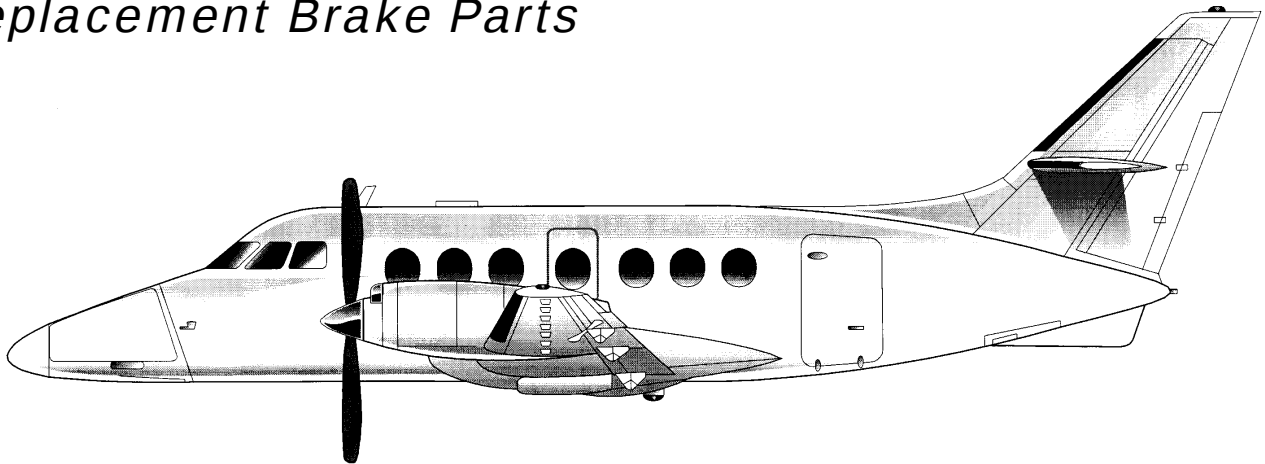

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES



440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call

(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



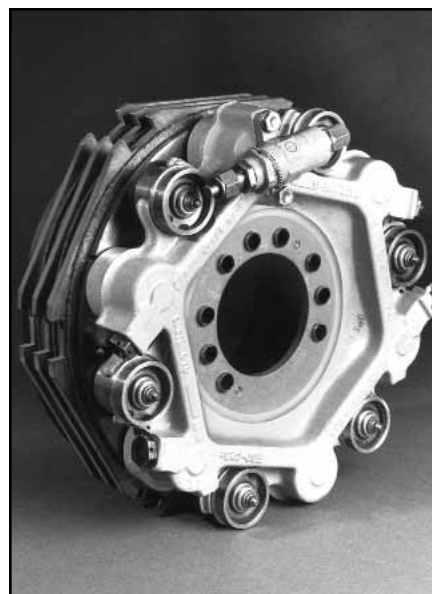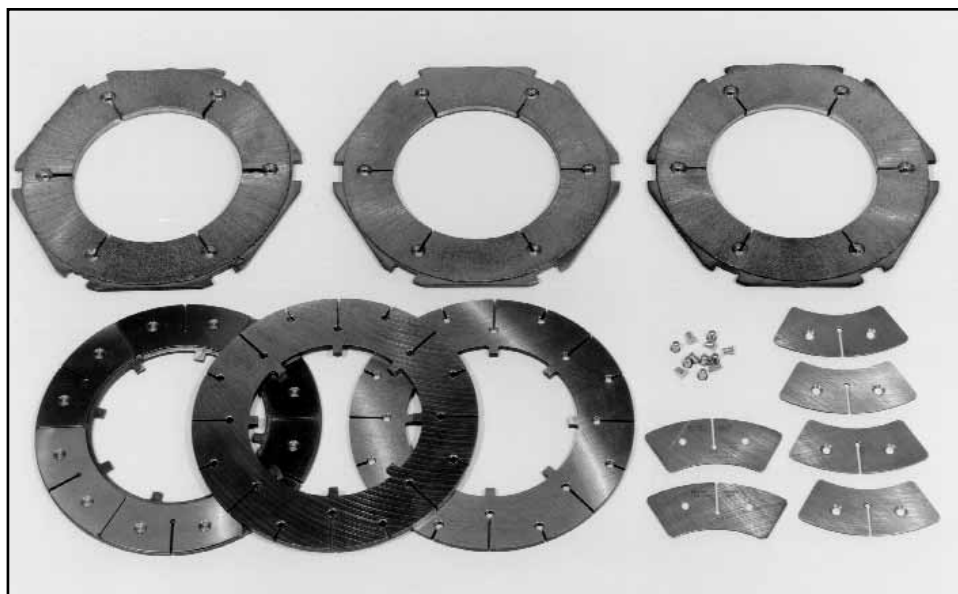

This Brake Kit fits the following:

Aerospace Jetstream: J-3101 equipped with B.F. Goodrich P.N. 2-1522-1 series brakes.

Rapco Fleet Support, Inc. to B.F. Goodrich Part Number cross reference:

QTY	Rapco Fleet Support Part No.	B.F. Goodrich Part No.	Part Description
3	RFS1010	244-594	Rotating Disc
2	RFS2005	133-593-1	Stationary Disc
12	RFS3010	93-438	Wear Pad
24	RFS78-135	78-135	Rivet
1	RFS5020*	309-21-3	Pressure Plate Assembly

* These parts are sold as a Sub-Assembly with the RFS3010 Wear Pads already riveted on. These parts are NOT sold as part of RFS-1522K Hot Pac kit.

FAA-PMA APPROVED
Replacement Brake Parts

RAPCO FLEET SUPPORT, inc.

AIRCRAFT BRAKES

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.

For a list of distributors, Please call



(262) 367-6210 Phone, (262) 367-6219 Fax

www.rfsbrakes.com



Beechcraft 1900

REPLACEMENT LANDING GEAR COMPONENTS

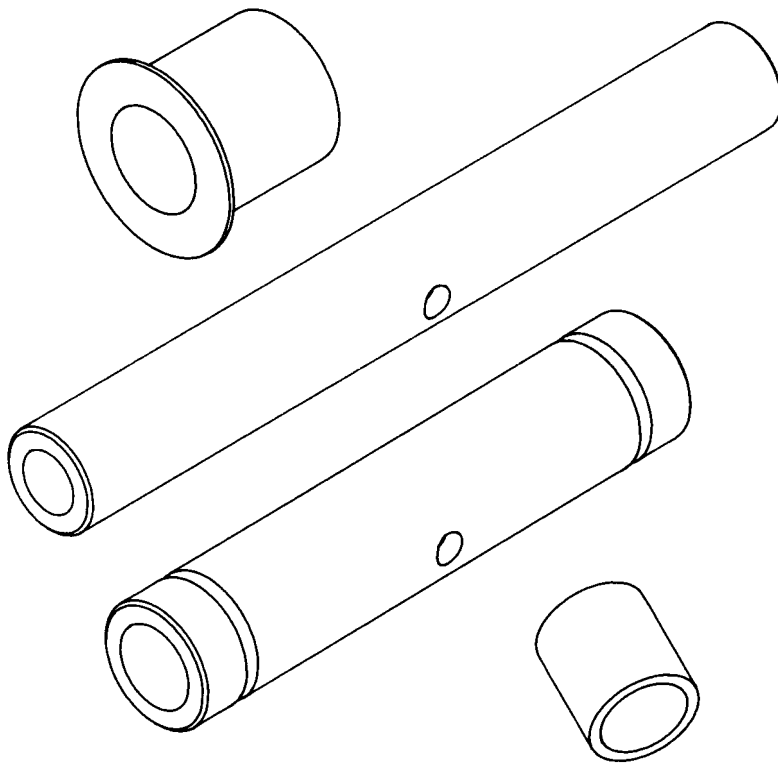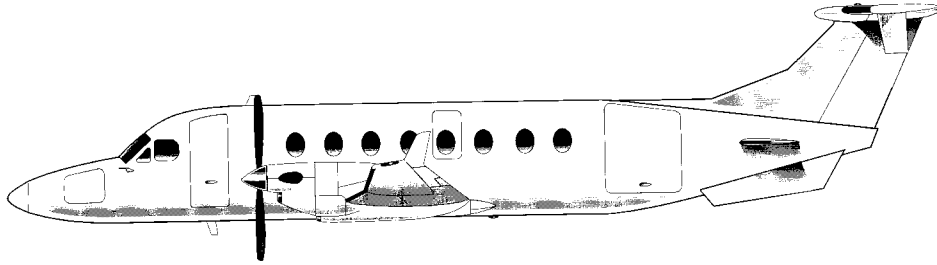

FAA-PMA APPROVED

Part Number	Description
RFS100-820017-1	Bushing
RFS101-810024-3	Bushing
RFS101-810026-1	Pin
RFS101-810090-3	Bolt
RFS105739X-YN1437	Bushing
RFS105739X-YR0875	Bushing
RFS105740X-YA0630	Bushing
RFS105740X-YA1625	Bushing
RFS105740X-YN0625	Bushing
RFS105740X-YN0677	Bushing
RFS114-810022-1	Axle
RFS114-810038-1	Bushing
RFS114-810042-1	Bushing
RFS114-820062-1	Bushing
RFS114-820068-1	Pin
RFS114-820112-1	Bushing
RFS114-820113-1	Bushing
RFS115-810066-3	Bushing
RFS50-810035-2	Pin
RFS50-810035-4	Pin
RFS90-820010-1	Bushing
RFS99-810066-1	Bushing

For OEM part number: Delete "RFS" in front of part number

RFS
RAPCO FLEET SUPPORT, inc.

440 Cardinal Lane, Hartland, Wisconsin 53029 U.S.A.
 For a list of distributors, Please call
 (262) 367-6210 Phone, (262) 367-6219 Fax
www.rfsbrakes.com





INSTALLATION ELIGIBILITY	RFS P/N	PART DESCRIPTION	SUPPLEMENT #
Beech 200, 200C	RFS-15K	'Hot Pac' brake repair kit	5
	RFS-15	Rotating disc	5
	RFS-27	Stationary disc	5
	RFS207-111	Carrier & lining	5
	RFS-151	Insulator for carrier & lining	5
Beech 200, 200C, 300	RFS101-8001-97	Adjuster sleeve	8
Beech 200, 300, B300, B300C, A200 (C-12A), A200 (C-12C), A200CT (C-12F)	RFS6375	Piston	25
Beech KA 200, 200C, 200CT, 200T, A200, A200C, B200, B200C, B200CT, B200T, 300, A300CT, 300LW, B300, B300C, B99, C99, A100, E90, F90	RFS34897-1	Mechanical shear shaft	23
Beech 200 (A-100-1(U-21J)), 200C, 200CT, 200T, A200 (C-12A or C-12C), A200C (UC-12B), A200CT (C-12D, FWC-12D, RC-12D, C12-F, RC-12G or RC-12H), B200, B200C (C-12F, UC-12F, UC-12M or C-12R), B200CT, B200T	RFS-2256K	'Hot Pac' brake repair kit	15
	RFS1030	Rotating disc	15
	RFS2015	Stationary disc	15
	RFS3030	Wear pad	15
	RFS4055	Pressure plate	15
	RFS5055	Pressure plate sub-assembly	15
	RFS4050	Back plate	15
	RFS5050	Back plate sub-assembly	15
	RFS18B7	Rivet	15
Beech 1900C, 1900D	RFS6749K	'Hot Pac' brake repair kit	12
	RFS1005	Rotating disc	12
	RFS3005	Wear pad	12
	RFS4010	Stationary disc	12
	RFS5005	Stationary disc sub-assembly	12
	RFS4015	Pressure plate	12
	RFS5010	Pressure plate sub-assembly	12
	RFS5015	Back plate sub-assembly – Exchange only	12
	RFS6A14	Rivet	12
	RFS6B5	Rivet	12
	RFS6B11	Rivet	12
	RFS34897-1	Mechanical shear shaft	14
Beech 1900C, 1900D	RFS6749K-1	'Hot Pac' brake repair kit	21
	RFS1005A	Rotating disc - HD (In kit if HD kit)	21
	RFS3005	Wear pad	21
	RFS4010	Stationary disc	21
	RFS5005	Stationary disc sub-assembly	21
	RFS4015	Pressure plate	21
	RFS5010	Pressure plate sub-assembly	21
	RFS5015A	Back plate sub-assembly – Exchange only	21
	RFS6A14	Rivet	21
	RFS6B5	Rivet	21
	RFS6B11	Rivet	21
	RFS6195	Tube for grip & tube sub-assembly	21
	RFS6200	Grip & tube sub-assembly	21
Beech 1900	RFS5008895-1	Torque tube	12
Beech 1900, 1900C, 1900D	RFS50-810035-2	Pin	10
	RFS50-810035-4	Pin	10
	RFS90-820010-1	Bushing	10
	RFS99-810066-1	Bushing	9
	RFS100-820017-1	Bushing	10
	RFS101-810024-3	Bushing	10
	RFS101-810026-1	Pin	10
	RFS101-810090-3	Bolt	17
	RFS114-810022-1	Main landing gear axle	9
	RFS114-810022-1K	Main landing gear axle kit	13
	RFS114-810038-1	Bushing	9
	RFS114-810042-1	Bushing	10
	RFS114-820062-1	Bushing	9
	RFS114-820068-1	Pin	17
	RFS114-820112-1	Bushing	10
	RFS114-820113-1	Bushing	17
	RFS115-810066-3	Bushing	10
	RFS140-04730	Hubcap	8
	RFS105739X-YN1437	Bushing	9
	RFS105739X-YR0875	Bushing	9
	RFS105740X-YA0630	Bushing	17
	RFS105740X-YA1625	Bushing	9
	RFS105740X-YN0625	Bushing	9
	RFS105740X-YN0677	Bushing	9
British Aerospace Jetstream 3101 (J-31)	RFS1522K	'Hot Pac' brake repair kit	5
	RFS1010	Rotating disc	5
	RFS2005	Stationary disc	5
	RFS3010	Wear pad	5
	RFS4020	Pressure plate	5
	RFS5020	Pressure plate sub-assembly	5
	RFS5045	Torque plate sub-assembly	5
	RFS78-135	Rivet	5
	RFS78-364	Rivet	5
Cessna Citation 500, 550	RFS-1446K	'Hot Pac' brake repair kit	19
	RFS1045	Rotating disc	19
	RFS2035	Stationary disc	19
	RFS3070	Wear pad	19
	RFS4105	Pressure plate	19
	RFS5065	Pressure plate sub-assembly	19
	RFS4110	Back plate	19
	RFS5060	Back plate sub-assembly	19
	RFS6105	Torque tube	19
	RFS6110	Keyway liner	19
	RFS6115	Piston	19
	RFS6125	Piston insulator	19
	RFS16B7	Rivet	19
	RFS16B9	Rivet	19
	RFS16B16	Rivet	19
Embraer EMB-120, EMB-120RT	RFS-1479K	'Hot Pac' brake repair kit	7
	RFS1015	Rotating disc	7
	RFS2010	Stationary disc	7
	RFS3010	Wear pad	7
	RFS4020	Pressure plate	7
	RFS5020	Pressure plate sub-assembly	7
	RFS5040	Torque plate sub-assembly	7
Embraer EMB-120ER, EMB-120RT	RFS-1585K	'Hot Pac' brake repair kit	14
	RFS1015	Rotating disc	14
	RFS2010	Stationary disc	14
	RFS3010	Wear pad	14



INSTALLATION ELIGIBILITY	RFS P/N	PART DESCRIPTION	SUPPLEMENT #
Embraer EMB-120ER, EMB-120RT (cont.)	RFS4020	Pressure plate	14
	RFS5020	Pressure plate sub-assembly	14
	RFS5040	Torque plate sub-assembly	14
	RFS78-364	Rivet	14
Embraer EMB-120ER, EMB-120RT	RFS-1661K	'Hot Pac' brake repair kit	20
	RFS1015-1	Rotating disc	20
	RFS2010-1	Stationary disc	20
	RFS5155	Stationary disc sub-assembly	20
	RFS3010	Wear pad	20
	RFS3080	Wear pad	20
	RFS4020	Pressure plate	20
	RFS5020-1	Pressure plate sub-assembly	20
	RFS5040-1	Torque plate sub-assembly	20
	RFS6A14	Rivet	20
	RFS78-364	Rivet	20
Fairchild SA226TC and Beechcraft F90, 99, 99A, A99, A99A, B99, C99, 100, A100, B100 when equipped with Beech p/n 115-8001-3 brake assembly	RFS-2587K	'Hot Pac' brake repair kit	1
	RFS2587	Rotating disc	1
	RFS207-4	Wear pad	1
	RFS-151	Insulator	
Fairchild SA227AC	RFS-1587K	'Hot Pac' brake repair kit	1
	RFS1587	Rotating disc	1
	RFS207-9	Wear pad	1
	RFS-151	Insulator	
Fairchild SA227-AC (C-26A), SA227-BC (C-26A), SA227-CC, SA227-DC (C-26B), SA227-PC, SA227-AT, SA227-TT	RFS-1640K	'Hot Pac' brake repair kit	18
	RFS1025	Rotating disc	18
	RFS3015	Wear pad	18
	RFS3020	Wear pad	18
	RFS3025	Wear pad	18
	RFS4035	Pressure plate	18
	RFS5025	Pressure plate sub-assembly	18
	RFS4040	Stationary disc	18
	RFS5030	Stationary disc sub-assembly	18
	RFS4045	Back plate	18
	RFS5035	Back plate sub-assembly	18
	RFS3655	Piston	25
	RFS8A15	Rivet	18
	RFS8B3	Rivet	18
	RFS8B7	Rivet	18
	RFS18B14	Rivet	18
Fairchild SA227-AC (C-26A), SA227-BC (C26A), SA227-AT, SA227-PC, SA227-TT	RFS6380	Piston	25
Falcon 20	RFS-9550504K	'Hot Pac' brake repair kit	26
	RFS1065	Rotating disc	26
	RFS2045	Stationary disc	26
	RFS5120	Stationary disc sub-assembly	26
	RFS3085	Wear pad	26
	RFS4125	Pressure plate	26
	RFS5110	Pressure plate sub-assembly	26
	RFS4130	Back plate	26
	RFS5115	Back plate sub-assembly	26
	RFS18A13	Rivet	26
	RFS18B8	Rivet	26
	RFS18B9	Rivet	26
	RFS18B16	Rivet	26
Hawker 600A, 700A	RFS-52787K	'Hot Pac' brake repair kit	24
	RFS1060	Rotating disc segment	24
	RFS5105	Rotating disc sub-assembly	24
	RFS2040	Stationary disc	24
	RFS5095	Stationary disc sub-assembly	24
	RFS3075	Wear pad	24
	RFS4115, RFS4116	Pressure plate	24
	RFS5091	Pressure plate sub-assembly	24
	RFS4120	Back plate	24
	RFS5100	Back plate sub-assembly	24
	RFS6210	Bushing, pressure & back	24
	RFS6215	Bushing, stationary	24
	RFS6220	Rivet spacer	24
	RFS80972-1	Rivet	24
	RFS80972-3	Rivet	24
	RFS80972-4	Rivet (alt. for use on Galex)	24
Hawker 800, 800XP	RFS-1897K	'Hot Pac' brake repair kit	22
	RFS1050	Rotating disc segment	22
	RFS5085	Rotating disc sub-assembly	22
	RFS2040	Stationary disc	22
	RFS5095	Stationary disc sub-assembly	22
	RFS3075	Wear pad	22
	RFS4115	Pressure plate	22
	RFS5090	Pressure plate sub-assembly	22
	RFS4120	Back plate	22
	RFS5100	Back plate sub-assembly	22
	RFS6210	Bushing, pressure & back	22
	RFS6215	Bushing, stationary	22
	RFS6220	Rivet spacer	22
	RFS6305	Wear indicator pin	22
	RFS6310	Indicator pin base	22
	RFS80972-1	Rivet	22
	RFS80972-3	Rivet	22
	RFS80972-4	Rivet (alt. for use on Galex)	22
Learjet 25, 31, 35, 35A, 36A	RFS-3096K	'Hot Pac' brake repair kit	4
	RFS4090	Pressure plate	4
	RFS5080	Pressure plate sub-assembly	4
	RFS4095	Stationary disc	4
	RFS5075	Stationary disc sub-assembly	4
	RFS4100	Back plate	4
	RFS5070	Back plate sub-assembly	4
	RFS5119	Wear pad	4
	RFS6029	Wear pad	4
	RFS6425	Rotating disc	4
	RFS18A15	Rivet	6
	RFS18B7	Rivet	6
	RFS18B9	Rivet	6
	RFS18B15	Rivet	6
Learjet 25, 35, 35A, 36, 36A, 55	RFS4090	Pressure plate	11
	RFS4095	Stationary disc	11
	RFS4100	Back plate	11
	RFS5006905	Torque tube	16

RAPCO FLEET SUPPORT, inc.

Brake Overhauls & Hot-Pac Kit Applications

Brakes are available OVERHAULED/EXCHANGE

****OR****

Order the corresponding kit to overhaul your own brakes

<u>Aircraft Type</u>	<u>Brake P/N</u>	<u>RFS Kit P/N</u>
NEW Falcon 20	9550504	RFS-9550504K
Raytheon / Hawker 800, 800XP	AHO89881 AHA1897	RFS-1897K RFS-1897K
Raytheon / Hawker 600, 700	AH52787	RFS-52787K
Cessna Citation	5001445-1, 2, 3, & 4 5001446-1, 2, 3, & 4	RFS-1446K RFS-1446K
Learjet 25, 31, 35, 35A, 36A	5003096-4 5003096-6	RFS-3096K RFS-3096K
King Air 200 & 200C	2-1576 101-8001-9 101-8001-91 101-380096-1 5002256 101-8002-3	RFS-15K RFS-15K RFS-15K RFS-15K RFS-2256K RFS-2256K
King Air F90, 100, A100, B100	115-8001-3	RFS-2587K
Beech 99 Airliner	115-8001-3	RFS-2587K
Fairchild Metro Series	2-1203	RFS-2587K
Fairchild Metro II & Merlin Series	2-1203-1 2-1203-2 2-1203-4	RFS-2587K RFS-1587K RFS-1587K
Fairchild Metro III	2-1203-3	RFS-1587K
Fairchild Heavy Metro	5011640-1 5011640-2	RFS-1640K RFS-1640K
B1900C & D	114-8008-3 5006749-4 114-388024-1 5006749-5	RFS-6749K RFS-6749K RFS-6749K-1 RFS-6749K-1
Jetstream 31	2-1522-1	RFS-1522K
EMB120	2-1479-1 2-1585 2-1661	RFS-1479K RFS-1585K RFS-1661K

Rapco Fleet Support Brakes and Hot-Pac Kits are available through our worldwide distribution network. For a distributor near you please call **262-367-6210** or see our website: www.rfsbrakes.com.

All Brake Parts FAA/PMA Approved for Direct Replacement